

RECEIVED

LARAMIE COUNTY  
CHEYENNE, WY.

CERTIFIED LAND CORNER RECORDATION '88 DEC 23 AM 9 09


DESCRIPTION OF CORNER EVIDENCE FOUND, AND ORIGINAL RECORD (if known)

Sec. 11 | Sec. 12 Found: Found 14" x 12" x 4" limestone, but in  
 Sec. 14 | Sec. 13 fenceline which appears to be 40 feet North of  
 the section line. No clear notches (very soft  
 stone). See notes on back.  
 Accessories found - None  
 GLO: "Set limestone 15" x 12" x 4" for corner to Secs.  
 11, 12, 13, 14."

DESCRIPTION OF MONUMENT AND ACCESSORIES ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THIS CORNER:


Set: See notes on back. Set 36" aluminum driveable monument with 3" aluminum cap, about 0.5 foot below surface. See Map of Survey filed with Laramie County Clerk for dimensions to adjacent corners. Set 2-5/8"x24" rebar with 2" cap stamped "ESMT COR" as shown.

SKETCH, WITH COURSE AND DISTANCE TO ADJACENT CORNER IF DETERMINED IN THIS SURVEY. (May Sketch or Paste Reproduction on Reverse Side.)

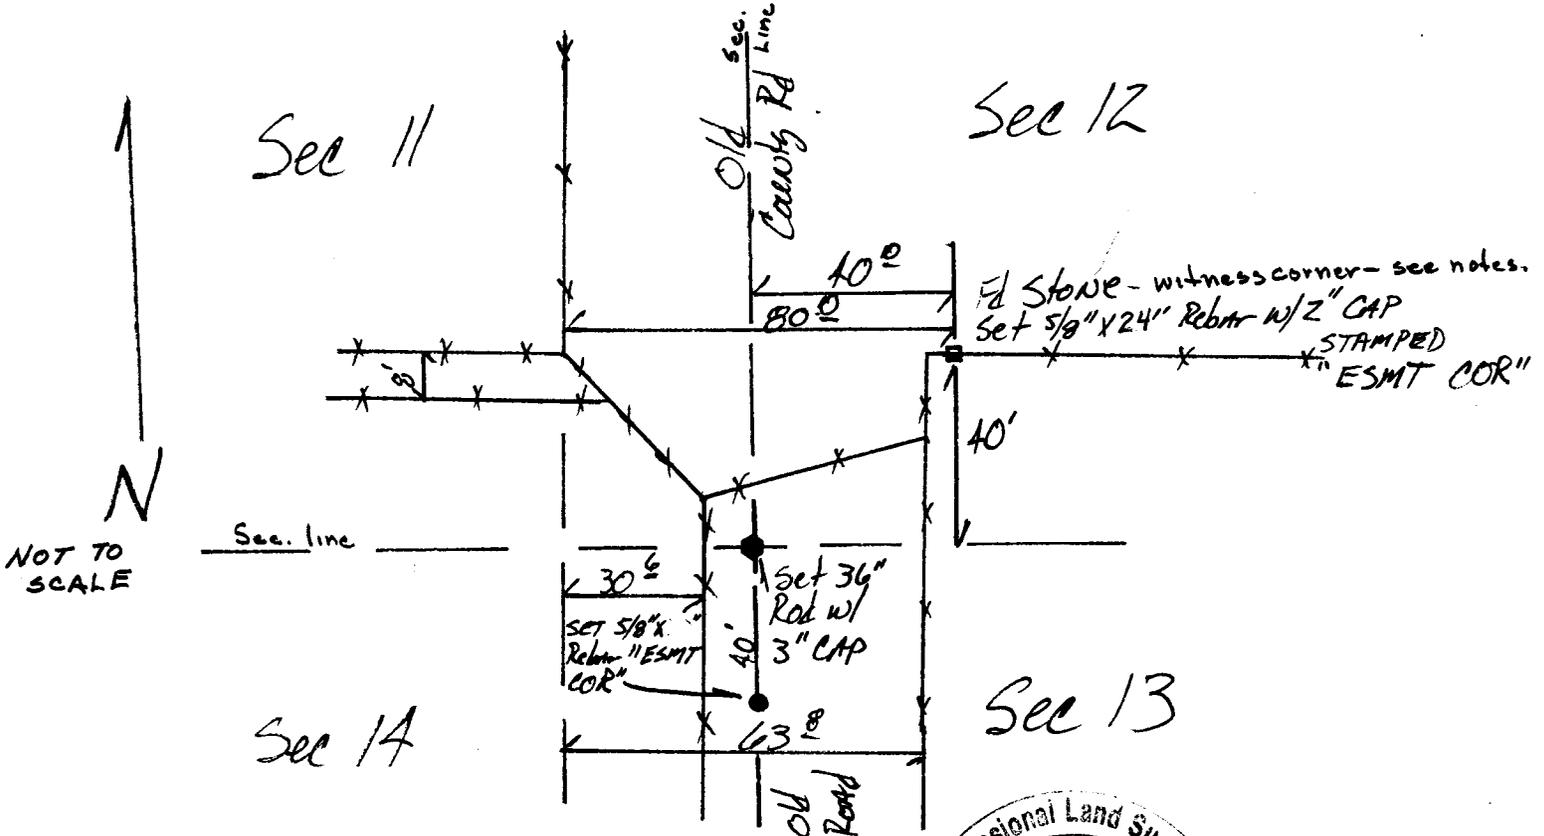

I, BECKY J. BRAMAN certify that I have carefully performed or reviewed the work done on the diagrammed corner as reported on this recordation form and approve the same.

Becky J. Braman PLS 3881  
Signature of Surveyor Registration No.

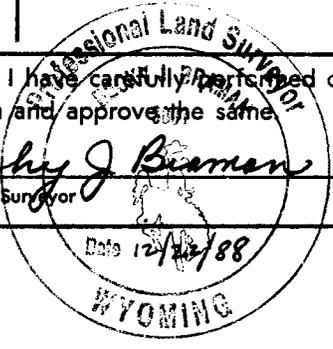

STATE OF WYOMING,  
Office of Clerk and Recorder,  
County of LARAMIE

This "corner record" was filed for record on the \_\_\_\_\_ day of \_\_\_\_\_, 19\_\_\_\_, was noted on the cross-index plat and is assigned page No. \_\_\_\_\_, in book No. \_\_\_\_\_.

County Official		
Cross Index No. <u>521</u>	T. <u>13N</u>	R. <u>65W 6<sup>th</sup></u> Mer.
_____	T. _____	R. _____ Mer.
_____	T. _____	R. _____ Mer.
_____	T. _____	R. _____ Mer.
_____	T. _____	R. _____ Mer.
_____	T. _____	R. _____ Mer.
_____	T. _____	R. _____ Mer.

Note: Laramie County Engineer's office has no specific notes on the witnessing of this road, but other notes, especially the Chalk Bluffs Road notes, show corners set 40 feet to the East and West of North-South road and set at 56.4 feet diagonally from intersections, usually NE and NW. In this case, my opinion is that the limestone which was found is the section corner, but in a disturbed position. Both to the north and to the east, the fence is built at 40 feet from well-evidenced corner positions. What I believe happened is that the crew setting the witness corners for the county roads re-used the section corner as a witness corner. Position for the corner was established at 40 feet south and 40 feet west from this limestone.