State of Wyoming Corner Record

CORNER PERPETUATION AND FILING ACT , Wyoming Statutes, 1997, (In compliance with the Section 33-29-140, et. seq., and the Rules and Regulations of the Board of Registration for Professional **Engineers and Professional Land Surveyors)**

Reverse side of this form may be used if more space is needed.

Record of original survey and citation of source of historical information (if corner is lost or obliterated). Description of corner monumentation evidence found and/or monument and accessories established to perpetuate the location of this corner. Sketch of relative location of monument, accessories, and reference points with course and distance to adjacent corner(s) (if determined in this survey). Method and rationale for reestablishment of lost or obliterated corner.

John B. Thomas, U.S. Deputy Surveyor, 1871 G.L.O. Record:

80.00 Chains Set a limestone 18 x 13 x 6

State of Wyoming Corner Record filed August 16, 2010 by Mr. Joesph W. Manatos, Wyoming PLS 573, indicating found Subsequent Record:

" a 3/4" spike set 2 1/2' below the surface of Laramie County Road 220."

On December 26, 2011, I found the above noted spike 3 ins. below the graded roadway of Laramie County Rod No. 220. Found: The found spike of unkown origin was 2.5 ft. south of the center line of Laramie County Road No. 220. On several subsequent surveys and with measurements to other found corners in the area, I did not accept the spike. The constructed roadway appeared to be on the section line as there was a "bend" in the county road at the longitudinal intersection of a fence north and trail road center line south. It was assumed that due care had been exercised in placing the road and improvements on the section line due to the "bend" in the road at the range line.


At the intersection of an old property bundary fence north and latitudinal center line of Laramie County Road No. 220, I set a no. 5 x 24 ins. rebar with 2 1/2 ins. diam. alum. cap, marked as noted below, 6 ins. below the graded county road.

From the monument:

The spike noted above bears south 2.5 ft. A 16d nail set in a fence corner post bears north 34.4 ft. A 16d nail set in a fence corner post bears southeast 47.8 ft.

The re-established northeast corner of Section 7, a 2 1/2 ins. diam. alum. cap, bears N89°27'E 5197.4 ft. The re-established southwest corner of Section 7, a 2 1/2 ins. diam. alum. cap, bears S0°15'W 5250.6 ft.


Aluminum Cap Markings

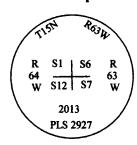

RECORDED 12/02/2013 AT 8:57 AM REC# 6 628419 BK# 2368 PG# 1417

Date of Field Work: November 15, 2013 Office Reference: Kaiser Francis Oil. Silo Field

CROSS INDEX DIAGRAM

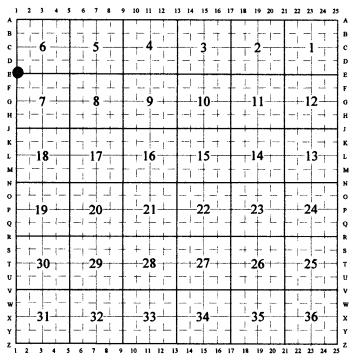

Firm/Agency, Address

Paul Reid, PLS 1533 Pinion Drive Cheyenne WY 82001 307-630-2387 (C) 307-637-3400 (O)

This corner record was prepared by me or under my direction and supervision.

SEAL & SIGNATURE



Corner Name: SW Corner Section: 6 *↓*-T. 15 N., R. 63 W., 6th P.M. SBRPEPLS/PLSW: MARCH 1994/97 T. 15 N., R. 64 W., 6th P.M.

Cross-Index No.: E-1